
Memory Module Specifications



HX436C18PB3K2/64

64GB (32GB 4G x 64-Bit x 2 pcs.)
DDR4-3600 CL18 288-Pin DIMM Kit

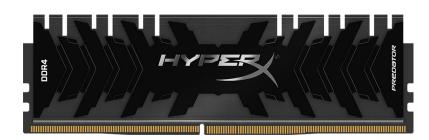

SPECIFICATIONS

17 cycles
45.75ns(min.)
350ns(min.)
32ns(min.)
32ns(min.) 94 V - 0
. ,

DESCRIPTION

HyperX HX436C18PB3K2/64 is a kit of two 4G x 64-bit (32GB) DDR4-3600 CL18 SDRAM (Synchronous DRAM) 2Rx8, memory module, based on sixteen 2G x 8-bit FBGA components per module. Each module kit supports Intel® Extreme Memory Profiles (Intel® XMP) 2.0. Total kit capacity is 64GB. Each module has been tested to run at DDR4-3600 at a low latency timing of 18-22-22 at 1.35V. The SPDs are programmed to JEDEC standard latency DDR4-2400 timing of 17-17-17 at 1.2V. Each 288-pin DIMM uses gold contact fingers. The JEDEC standard electrical and mechanical specifications are as follows:

XMP TIMING PARAMETERS

Default (JEDEC): DDR4-2400 CL17-17-17 @1.2V
 XMP Profile #1: DDR4-3600 CL18-22-22 @1.35V
 XMP Profile #2: DDR4-3000 CL16-18-18 @1.35V


FEATURES

- Power Supply: VDD = 1.2V Typical
- VDDQ = 1.2V Typical
- VPP = 2.5V Typical
- VDDSPD = 2.2V to 3.6V
- On-Die termination (ODT)
- 16 internal banks; 4 groups of 4 banks each
- Bi-Directional Differential Data Strobe
- 8 bit pre-fetch
- Burst Length (BL) switch on-the-fly BL8 or BC4(Burst Chop)
- Height 1.661" (42.20mm)


Continued >>



MODULE WITH HEAT SPREADER

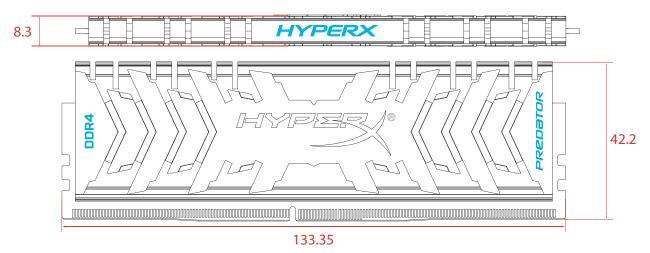


MODULE DIMENSIONS

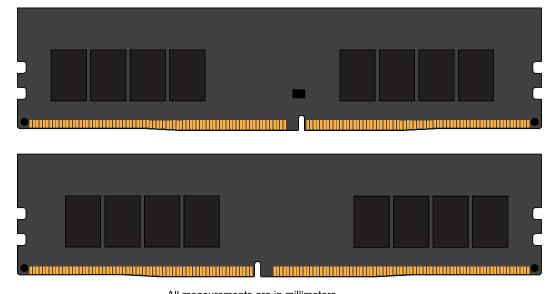

All measurements are in millimeters.

(Tolerances on all dimensions are ±0.12 unless otherwise specified)

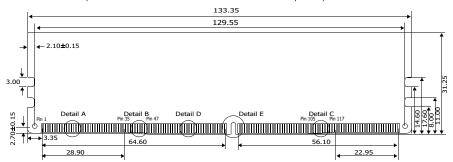

The product images shown are for illustration purposes only and may not be an exact representation of the product. Kingston reserves the right to change any information at anytime without notice.

FOR MORE INFORMATION, GO TO WWW.HYPERXGAMING.COM

All Kingston products are tested to meet our published specifications. Some motherboards or system configurations may not operate at the published HyperX memory speeds and timing settings. Kingston does not recommend that any user attempt to run their computers faster than the published speed. Overclocking or modifying your system timing may result in damage to computer components.